


Case IH 2600 / 4200 / 4400 SERIES - New Holland 99C/980 G4 TOOLBAR MOUNT STALK STOMPER

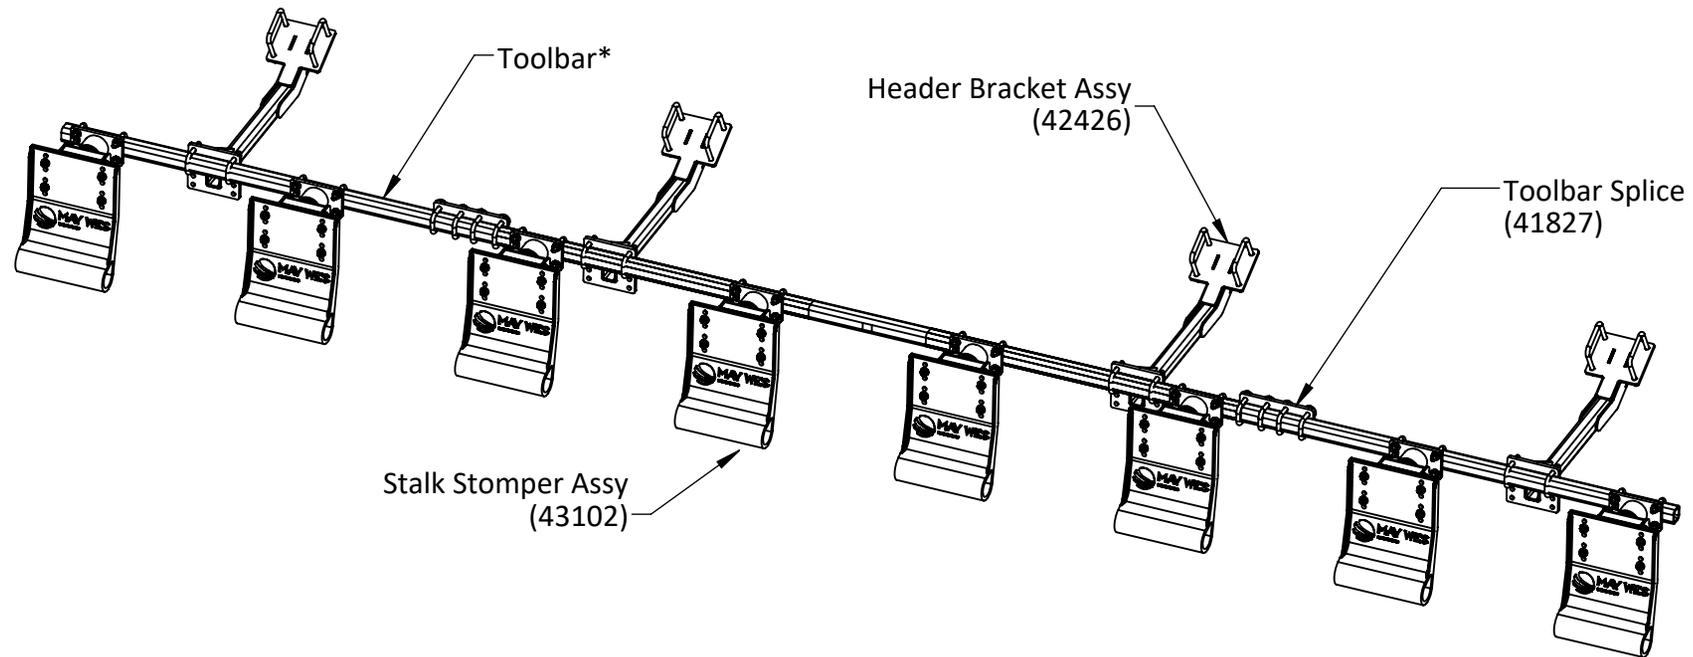

Notes:

- Illustration shown is for reference purposes only. Quantities and components will vary. Please refer to individual component parts listings for specific information.

* Toolbar is not included in all kits. If a kit without Toolbar was ordered, the customer is responsible for providing required Toolbar.




MAY WES
Original Poly People
A DIVISION OF PRIDE SOLUTIONS

120 Eastgate Drive SE
Hutchinson, MN 55350

1-800-788-6483
1-320-587-2322
1-320-587-6112 (Fax)

WWW.MAYWES.COM

Case IH 2600 / 4200 / 4400 SERIES - New Holland 99C/980 G4 TOOLBAR MOUNT STALK STOMPER

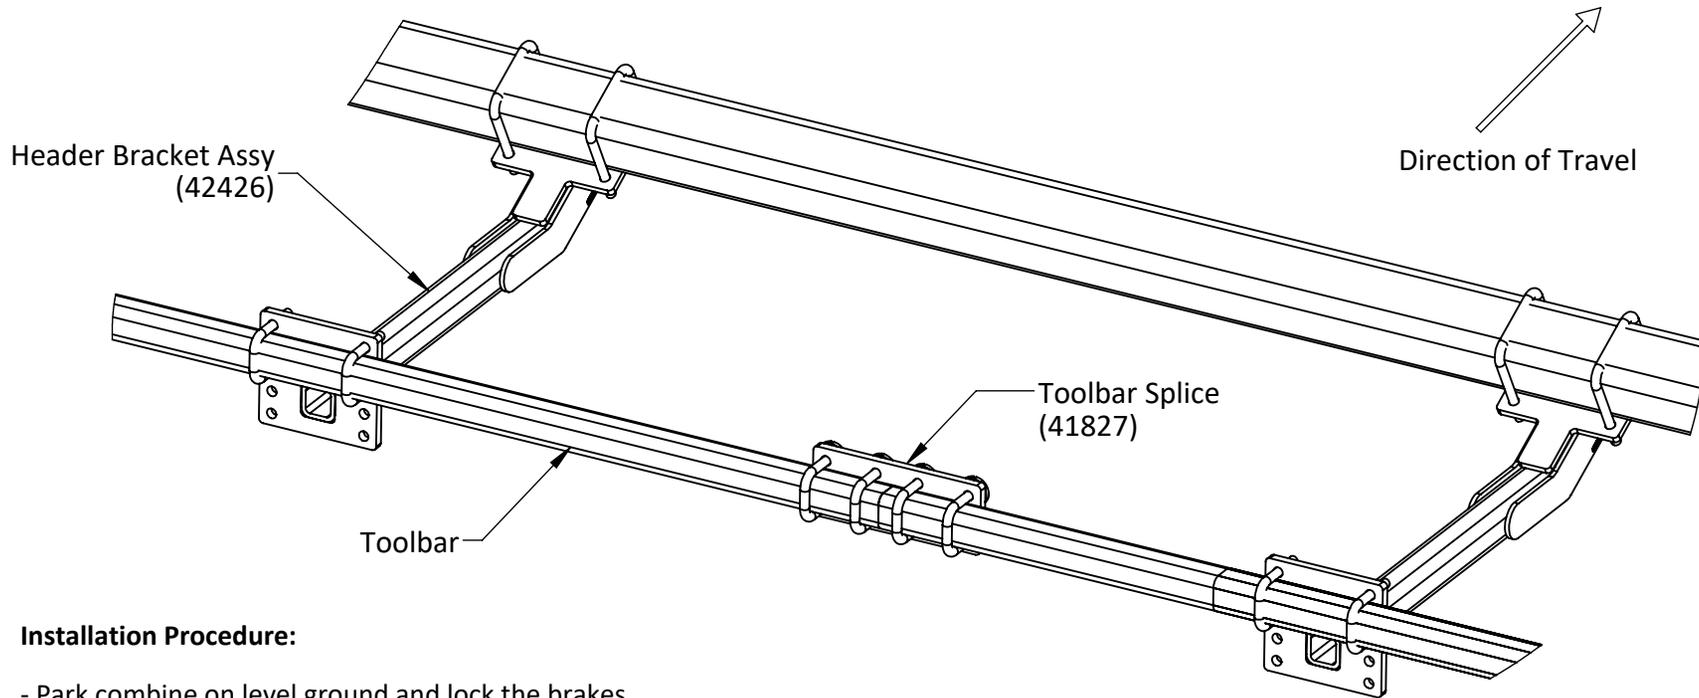

Installation Procedure:

- Park combine on level ground and lock the brakes.
- Raise the head and lock in the upright position.
- Mount the Header Brackets to the 4" x 4" frame beam on the bottom of the corn head. Place the U-Bolts over the top of the 4 x 4 frame beam.
- Place the Header Bracket Assembly (42426) below the 4 x 4 frame tube and between the row units.
- Mount two Header Brackets on each side of the head, positioning the brackets where needed while keeping as much distance between them as possible.
- Mount toolbar (2" x 2" square tube) to the mounting brackets using the 2" U-Bolts and lock nuts provided.
Note: Toolbars may need to be trimmed to fit.
- Connect tool bars with splice plates, where needed.
NOTE: Make sure splice brackets do not interfere with positions of the Stalk Stomper Units




120 Eastgate Drive SE
Hutchinson, MN 55350

1-800-788-6483
1-320-587-2322
1-320-587-6112 (Fax)

WWW.MAYWES.COM

Case IH 2600 / 4200 / 4400 SERIES - New Holland 99C/980 G4 TOOLBAR MOUNT STALK STOMPER

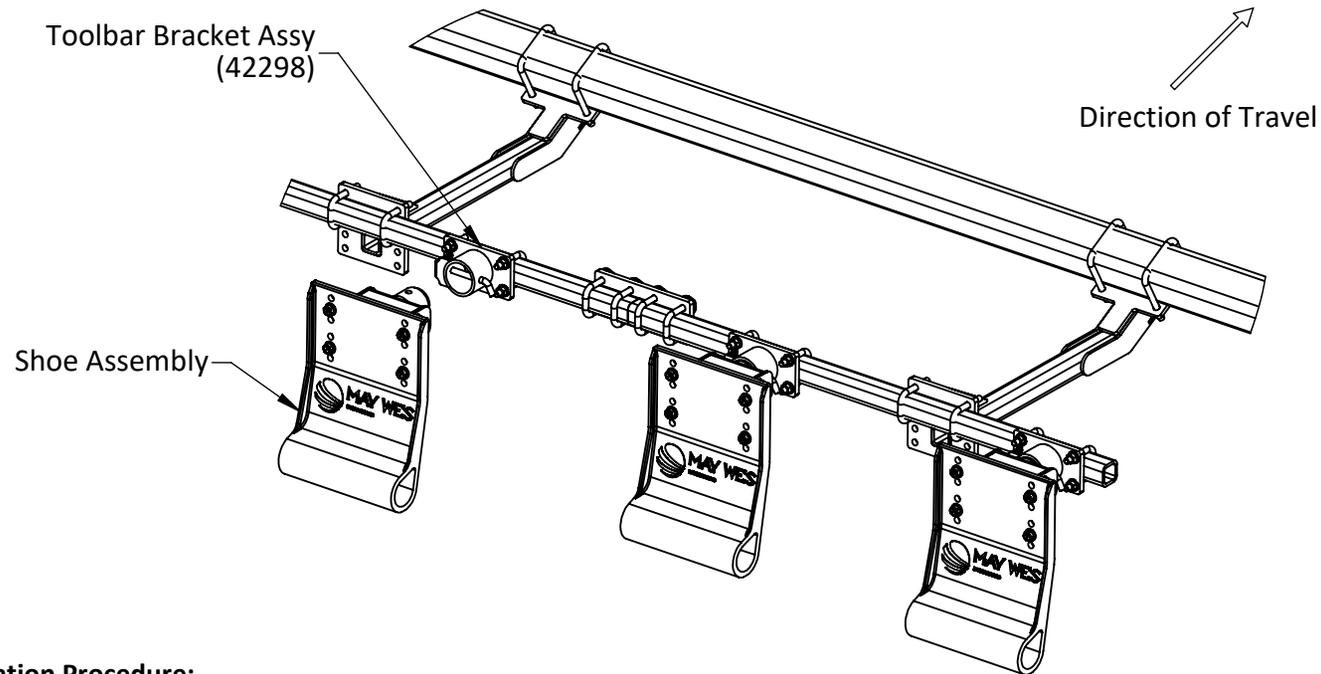

Installation Procedure:

- On flat ground, lower the head to approximate working height.
- Attach Toolbar Brackets using U-Bolts and nuts, behind the center of each row to be stomped.
- Lift Stalk Stomper Assembly into mating features on the mounting bracket and attach with pin and clip.
- Height can be adjusted by repositioning the shoe to the torsion unit. Each hole set will adjust the height by 1"

NOTE:

Refer to G4 Stalk Stomper Instruction (Document 10274) for Setup, Operation, Maintenance, Transport and Storage Instructions




120 Eastgate Drive SE
Hutchinson, MN 55350

1-800-788-6483
1-320-587-2322
1-320-587-6112 (Fax)


WWW.MAYWES.COM

**Case IH 2600 / 4200 / 4400 SERIES - New Holland 99C/980
G4 TOOLBAR MOUNT STALK STOMPER**

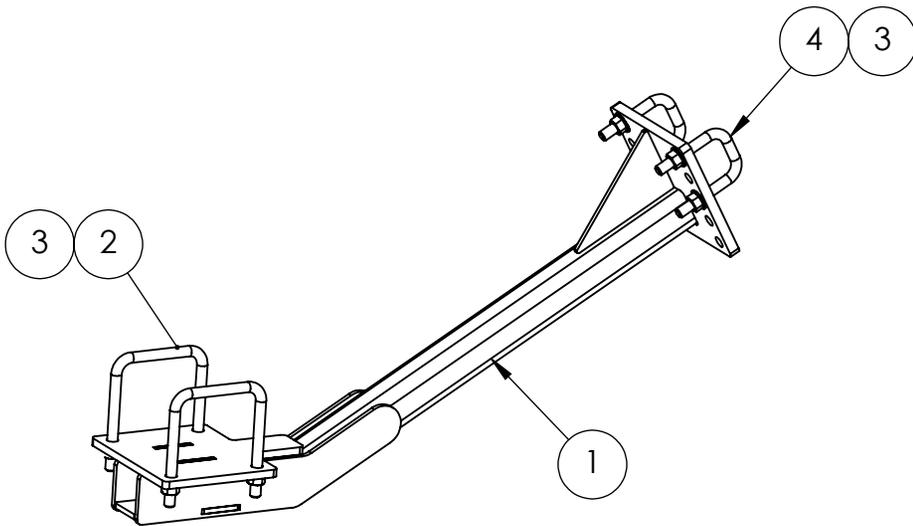

42426 - Header Bracket Assembly

4	00986	U-BOLT 1/2"-13 X 2"	2
3	00730	NUT, 1/2"-13 HEX FLANGE	8
2	00965	U-BOLT 1/2"-13 x 4"	2
1	42424	BRACKET, CIH 4412 HEADER	1
ITEM #	PART #	DESCRIPTION	QTY.

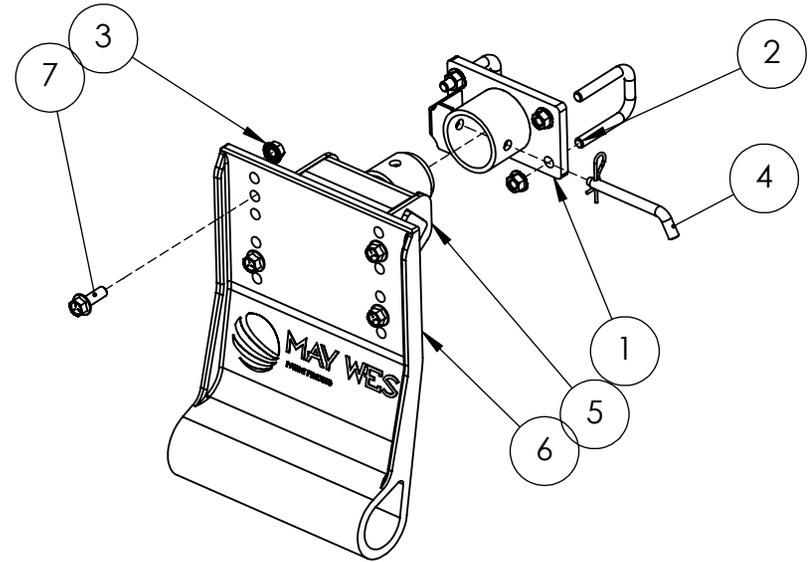

43102 - Stalk Stomper Shoe Assembly

7	00729	BOLT, 1/2"-13 X 1-1/2" HEX FLANGE	4
6	24100	SHOE, G4 MOLDED	1
5	42295	STALK STOMPER TORSION ASSY	1
4	01130	PIN, 1/2" X 4" BENT HITCH	1
3	00730	NUT, 1/2"-13 HEX FLANGE	8
2	00986	U-BOLT 1/2"-13 X 2"	2
1	42298	WLDMT; TOOLBAR MNT BRKT	1
ITEM #	PART #	DESCRIPTION	QTY.



120 Eastgate Drive SE
Hutchinson, MN 55350

1-800-788-6483
1-320-587-2322
1-320-587-6112 (Fax)

WWW.MAYWES.COM