## **Installation Instructions**

JD 1770 Planter Stalk Stompers



PLEASE REFER TO YOUR EQUIPMENT MANUFACTURER'S
OPERATORS MANUAL FOR PERTINENT SAFETY PRECAUTIONS

## **!** IMPORTANT

Read all instructions before starting installation

- 1. Unfold planter to access front side of toolbar
- 2. Install mount brackets (43094) on front side of toolbar and secure by placing mounting straps (22690) on the back side of toolbar and fasten using supplied 1/2" x 8-1/2" bolts and lock nuts (Figure 1a & 1b)
- 3. Secure 2x2 toolbar to mount brackets using supplied u-bolts (00986) and flange nuts (figure 2)
- 4. Align G4 stalk stomper shoes with center of tire(s) and secure with supplied u-bolts (00986) and flange nuts (Figure 2)

## **Setup/Operating Recommendations:**

May Wes stalk stompers are intended to be setup/operated with minimal to no ground contact and minimal spring pressure during field operation. To achieve the recommended operating setup, with the planter parked on a hard, level surface lower the planter to field operating height. With the planter at operating height, the stalk stompers should be 1 to 2 inches above the ground.

## **Maintenance Recommendations:**

Your May Wes G4 stalk stompers should require minimal maintenance during operation. During rountine equipment maintenance, visually inspect the stalk stompers and mounting brackets for any damaged parts and repair or replace as necessary. Check all mounting hardware to ensure tightness and retighten if necessary.



Figure 1a

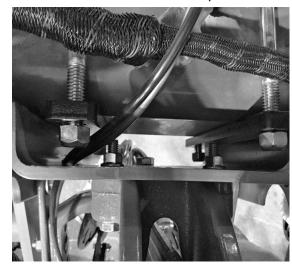


Figure 1b



Figure 2



120 Eastgate Drive SE Hutchinson, MN 55350


1-800-788-6483

1-320-587-2322

1-320-587-6112 (Fax)

**WWW.MAYWES.COM** 

PAGE 1 OF 2 Doc #: 10308\_A

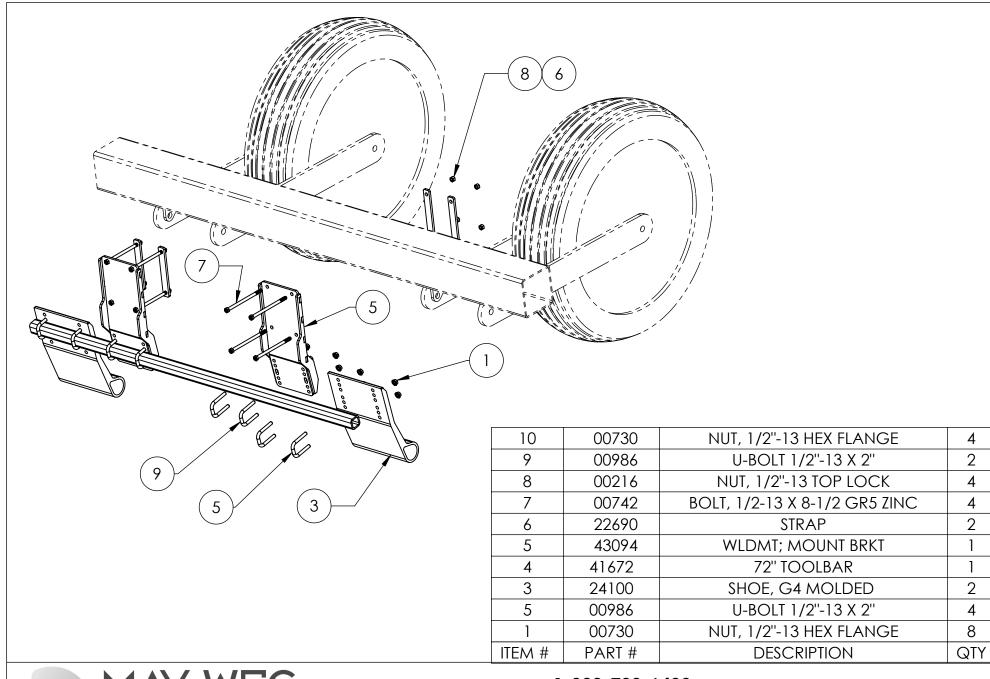



120 Eastgate Drive SE Hutchinson, MN 55350

1-800-788-6483 1-320-587-2322 1-320-587-6112 (Fax)

**WWW.MAYWES.COM**